

## Delineation and Mapping of Groundwater Quality in Coastal Blocks of Tiruvallur District of Tamil Nadu Using GIS

D. Reethika<sup>a\*</sup>, M. Baskar<sup>b#</sup>, D. Janaki<sup>b‡</sup>, S. Rathika<sup>c‡</sup>  
and R. Jagadeeswaran<sup>d†</sup>

<sup>a</sup> Department of Soil Science and Agricultural Chemistry, ADAC&RI, Trichy, India.

<sup>b</sup> Department of Soil Science and Agricultural Chemistry, ADAC&RI, Trichy, Tamil Nadu, India.

<sup>c</sup> Department of Agronomy, ADAC & RI, Trichy, Tamil Nadu, India.

<sup>d</sup> Department of Remote Sensing and GIS, TNAU, Coimbatore, India.

### Authors' contributions

This work was carried out in collaboration among all authors. All authors read and approved the final manuscript.

### Article Information

DOI: 10.9734/IJECC/2022/v12i1131123

### Open Peer Review History:

This journal follows the Advanced Open Peer Review policy. Identity of the Reviewers, Editor(s) and additional Reviewers, peer review comments, different versions of the manuscript, comments of the editors, etc are available here: <https://www.sdiarticle5.com/review-history/90775>

Original Research Article

Received 02 June 2022  
Accepted 08 August 2022  
Published 11 August 2022

### ABSTRACT

An investigation was carried out to assess the quality of groundwater in coastal blocks of Tiruvallur district, Tamil Nadu. Approximately fifty groundwater samples were obtained from the coastline blocks in May 2022, particularly Minjur (25 Nos), Puzhal (7 Nos,) and Gummidipoondi (18 Nos). The groundwater samples were tested for physio-chemical (pH and EC) and chemical characteristics like cations-Ca<sup>2+</sup>, Mg<sup>2+</sup>, Na<sup>+</sup>, K<sup>+</sup> and anions- CO<sub>3</sub><sup>2-</sup>, HCO<sub>3</sub><sup>-</sup>, Cl<sup>-</sup>, and SO<sub>4</sub><sup>2-</sup>; and the resultant properties were computed (SAR and RSC). The pH of Minjur, Puzhal, Gummidipoondi blocks ranged from 7.66 to 8.78, 7.77 to 8.36 and 7.35 to 8.76 respectively. The EC of Minjur, Puzhal, Gummidipoondi were 0.3 to 3.56 dS m<sup>-1</sup>, 0.76 to 2.91 dS m<sup>-1</sup> and 0.2 to 2.07 dS m<sup>-1</sup> respectively. The SAR of Minjur, Puzhal, and Gummidipoondi ranged from 1.60 to 11.73, 1.67-10.01, 0.6 to 6.87 respectively. The RSC of Minjur, Puzhal, Gummidipoondi ranged from -4 to 8.4

\* PG Research Scholar;

# Professor and Head;

‡ Assistant professor;

† Associate Professor (SS&AC);

\*Corresponding author: E-mail: reethuanish2498@gmail.com;

meq l<sup>-1</sup>, -0.8 to 3.4 meq l<sup>-1</sup>, -4.4 to 4.8 meq l<sup>-1</sup> respectively. In the Minjur block, the majority quality of groundwater was characterized as good quality water (32 per cent), salty water (24 per cent), and alkali water (36 per cent). While in the Puzhal block, the majority quality of groundwater was characterized as good quality water (28.57 per cent), saline water (14.28 per cent), and alkali water (57.14 per cent). In the Gummidipoondi block, the majority quality of groundwater was assessed as good quality water (38.8 percent), and alkali water (50 per cent).

**Keywords:** Coastal block; groundwater quality; Tiruvallur district; SAR and RSC.

## 1. INTRODUCTION

For the development of any activity in the country, water plays a vital role. Water is used for domestic purposes, irrigation and agricultural purpose, industrial purposes and for power development. Water is a priceless gift from nature to humanity; Groundwater can be found almost anywhere. Groundwater supplies more than 85% of India's rural residential water needs, 50% of its urban water needs, and more than 50% of its irrigation needs Jha et al. [1]. Groundwater is the water present beneath the earth's surface in soil pores. Water percolates through the soil and enters an aquifer. More than 90 per cent of groundwater in India is used for irrigated agriculture. Ground water, surface water and meteoric water are the major sources of water. The water obtained from precipitation is known as meteoric water (snow and rain). This includes water from lakes, rivers, and icemelts, all of which are indirectly caused by precipitation. Groundwater's efficiency was high when compared to the surface water. For the management of various natural resources, GIS and remote sensing tools are widely used.

Tiruvallur district is the northernmost coastal district of Tamil Nadu. district is bounded by the Bay of Bengal in the East, Vellore district of Tamil Nadu and Chittoor district of Andhra Pradesh on the North and on the South by Kancheepuram district. It is between 12°55' N to 13°34' N latitude to 80°21' E longitude and has an area of 3550 sq.km. There are 14 blocks in Tiruvallur district, viz., Ellapuram, Gummidipoondi, Kadambathur, Minjur, Pallipattu, Poonamallee, Poondi, Puzhal, R.K.Pet, Sholavaram, Tiruvallur, Tirutani, Thiruvallur, Ambathur in which Puzhal, Minjur and Gummidipoondi comes under coastal line.

Groundwater quality assessment is important for identifying the salt and sodicity problems in the

soil. Geographical Information System (GIS), the best option to assess the groundwater quality using water quality parameter overlay analysis. Hence the present investigation was envisaged to assess the ground water quality of coastal blocks of Tiruvallur district.

## 2. MATERIALS AND METHODS

50 water samples were collected in the Tiruvallur district's coastal blocks of Minjur (25 samples), Puzhal (07 samples) and Gummidipoondi (18 samples) during May 2022. The coordinates of the sample site were recorded using a portable GPS receiver (GPS, Garmin). A pre-cleaned plastic polyethylene bottle was used to collect samples. Prior to sampling, all sample containers were thoroughly cleaned and washed with groundwater. The water samples were analyzed for pH, Electrical Conductivity, cations-Ca<sup>2+</sup>, Mg<sup>2+</sup>, Na<sup>+</sup>, K<sup>+</sup> and anions- CO<sub>3</sub><sup>2-</sup>, HCO<sub>3</sub><sup>-</sup>, Cl<sup>-</sup>, and SO<sub>4</sub><sup>2-</sup>. pH and EC was determined by pH meter and EC meter respectively. The cations such as Ca<sup>2+</sup>, Mg<sup>2+</sup> was determined by vesrsanate technique, while Flame Photometry was used to determine Na<sup>+</sup>, K<sup>+</sup>. Titrimetric determination of anions such as CO<sub>3</sub><sup>2-</sup>, HCO<sub>3</sub><sup>-</sup>, Cl<sup>-</sup>, and SO<sub>4</sub><sup>2-</sup> was determined using Richards' (1954) standard method. Other quality indicators, such as the Sodium Adsorption Ratio (SAR) and Residual Sodium Carbonate (RSC), were calculated using the formula below:

$$SAR = \frac{Na^+}{\sqrt{(Ca^{2+} + Mg^{2+})/2}}$$

$$RSC = (CO_3^{2-} + HCO_3^-) - (Ca^{2+} + Mg^{2+})$$

The Central Soil Salinity Research Institute (CSSRI), Karnal uses the EC, SAR, and RSC values to determine whether groundwater samples are suitable for irrigation (Table 1). Arc GIS 10.1 software was used to create thematic maps of groundwater quality in the Tiruvallur area.

**Table 1. EC, SAR, and RSC values for determination of groundwater samples**

Water quality	EC (dS/m)	SAR (meq/l)	RSC (meq/l)
A. Good	<2	<10	<2.5
B. Saline			
i. Marginal saline	2-4	<10	<2.5
ii. Saline	>4	<10	<2.5
iii. High-SAR saline	>4	>10	<2.5
C. Alkali water			
i. Marginally alkali	<4	<10	2.5-4.0
ii. Alkali	<4	<10	>4.0
iii. Highly alkali	Variable	>10	>4.0
D. Toxic water	Although the salinity, SAR, and RSC of the hazardous water are different, it contains excessive amounts of certain ions, including chloride, sodium, nitrate, boron, fluoride, and heavy metals including selenium, cadmium, lead, and arsenic, among others.		

### 3. RESULTS AND DISCUSSION

#### 3.1 Physio-Chemical Properties

Minjur, Puzhal, and Gummidipoondi had pH values ranging from 7.66 to 8.78, 7.77 to 8.36, and 7.35 to 8.76, respectively. The EC of the Minjur, Puzhal, and Gummidipoondi blocks ranges from 0.3 to 3.56 dS m<sup>-1</sup>, 0.76 to 2.91 dS m<sup>-1</sup>, and 0.2 to 2.07 dS m<sup>-1</sup> respectively. SAR of Minjur, Puzhal, and Gummidipoondi ranged from 1.60 to 11.73, 1.67-10.01, and 0.6 to 6.87 respectively. RSC of Minjur, Puzhal, and Gummidipoondi ranged from -4 to 8.4 meq l<sup>-1</sup>, -0.8 to 3.4 meq l<sup>-1</sup>, and -4.4 to 4.8 meq l<sup>-1</sup> respectively. Good quality water (32%), salty water (24%), and alkali water (36%), were discovered in the Minjur block, while good quality water (28.57%), saline water (14.28%), and alkali water (57.14%) were discovered in the Puzhal block. Good quality water (38.8 percent) and alkali water (50 percent) were discovered in Gummidipoondi block. The variance in EC is greater in coastal groundwater due to man-made activities such as fertiliser misuse, mineral dissolution, and salt water intrusion [2].

#### 3.2 Cationic Concentration

Calcium, magnesium, potassium, and sodium concentrations in Minjur block ranged from 1.2 to 14.4, 0.8 to 9.6, 0.1 to 2.105, 4.676 to 25.72 meq l<sup>-1</sup> respectively. The cationic concentrations viz calcium, magnesium, potassium, and sodium in the Puzhal block ranged from 2.2 to 5.2, 0.4 to 6.4, 0.076 to 0.0369, 3.74 to 18.01 meq l<sup>-1</sup>. At Gummidipoondi block the cationic concentrations of calcium, magnesium, potassium, and sodium ranged from 1.2 to 7.3, 0.8 to 9.6, 0.092 to 0.546, 1.263 to 11.1 meq l<sup>-1</sup>. Sodium, magnesium,

calcium, and potassium is the order of the highest relative cationic concentrations. According to Mohanty et al. [3], the presence of Na and Cl ions in coastal groundwater indicates that seawater interacts with groundwater. Mg is frequently greater than Ca in various sites, according to Mondal et al. [4], which could be due to the effect of the sea in that area. The main sources of high calcium content are limestone, dolomite, and gypsum, and their breakdown causes an increase in calcium in groundwater [5].

In coastal aquifers, the weathering of clay minerals and potash feldspar raises the potassium content in the water [3].

#### 3.3 Anionic Concentration

Carbonate, Bicarbonate, Sulphate, and Chloride concentrations in Minjur block ranged from 0 to 8, 2 to 18, 0.152 to 2.756 and 2.0 to 22.1 meq l<sup>-1</sup> respectively. The cationic concentrations of calcium, magnesium, potassium, and sodium in the Puzhal block ranged from 4 to 8, 2 to 8, 0.141 to 6.386, and 1.6 to 17.4 meq l<sup>-1</sup>. At Gummidipoondi block cationic concentrations of calcium, magnesium, potassium, and sodium ranged from 2 to 8, 2 to 8, 0.004 to 1.007, and 1.2 to 15.2 meq l<sup>-1</sup>. The relative anionic concentrations were in the following order: chloride, bicarbonate, carbonate, and sulphate. The chloride, which is formed by rain or saline water intrusion along the seashore, is actively circulating in groundwater at relatively shallow depths.

#### 3.4 Water Quality Parameters

SAR of Minjur, Puzhal, and Gummidipoondi ranged from 2.38 to 15.1, 1.67 to 11.8, and 0.6 to

5.22, respectively. RSC of Minjur, Puzhal, and Gummidipoondi ranged from 4.4 to 8.4 meq l<sup>-1</sup>, -0.8 to 3.4 meq l<sup>-1</sup>, and -4.4 to 4.8 meq l<sup>-1</sup>, respectively. The high sodium level in the water sample reduces permeability, reducing the amount of water available to the plant [6].

The rise in exchangeable sodium in the soil is caused by an increase in the SAR of irrigation water [7].

At Minjur block, good quality water was around 32 per cent; Marginally saline water was around 24%; Marginally alkali water was 20%; Highly alkali water was 8%; and alkali water was 8%. At Puzhal block, good quality water was around 28.57 per cent; Marginally saline water was around 14.28%; Marginally alkali water was 57.14%. At Gummidipoondi block, good quality water was around 38.8 per cent; Marginally alkali water was 44.4%; and alkali water was 11.11%. Marginally saline water was highest in Minjur block (24 per cent). The marginally and highly alkali water was highest in Puzhal block (57.14 per cent & 8 per cent). The alkali water

was highest in Gummidipoondi block (11.11 per cent).

Higher RSC values suggest that much of the calcium and some magnesium ions precipitate from the solution, increasing the amount of sodium in water and soil particles and therefore increasing the possibility for sodium hazard. (Singh *et al.*, 2020). A high RSC may hinder air and water movement through the soil pore space, causing soil deterioration and rendering the soil unfit for irrigation [8].

Sodium in the water can displace calcium and magnesium, irrigation with high SAR water may necessitate soil additives to prevent long-term soil damage. This will also result in a decrease in soil infiltration and permeability to water, as well as loss in soil structure. It causes problems in agricultural production [9,10]. Saline irrigation has a negative impact on plant growth, owing to osmotic pressures in the soil, which tend to reduce the amount of nutrient taken up by the plant. Adopting various irrigation management techniques such as drip, sprinkler, and pitcher

**Table 2. Quality of groundwater in coastal blocks of Tiruvallur district**

**Minjur:**

Sample No	Village name	pH	EC	SAR	RSC	Water Quality Categories(CSSRI)
1	Nallur	7.66	3.25	3.19	1.6	Good
2	Mettupalayam	7.76	2.67	2.99	0.4	Marginally saline
3	Vannipakkam	8.01	1.3	2.54	2.8	Marginally alkali
4	Elayampedu	7.85	2.06	3.90	2.2	Good
5	Athreyamangalam	7.89	1.72	3.54	1.2	Good
6	Thadamperumbakkam	8.21	1.55	3.84	1.2	Good
7	Ponneri I	8.09	1.3	3.16	1.2	Good
8	Chinnakavanam I	8.42	0.86	2.05	4.2	Marginally alkali
9	Chinnakavanam II	8.2	1.01	1.60	0.4	Good
10	Arasur	8.37	0.65	4.70	4.1	Alkali
11	Guduvanchery	8.35	0.88	4.06	3.2	Marginally alkali
12	Knagavalipuram	8.24	1.74	4.56	4	Marginally alkali
13	Katavoor	8.01	2.96	6.45	-3.6	Marginally saline
14	Arasur	8.39	0.38	6.82	4.8	Alkali
15	Medur	7.86	3.15	7.37	-4.4	Marginally saline
16	Thirupalaivenam	8.09	2.95	6.26	-4	Marginally saline
17	Pralayampalayam	8.15	2.27	7.91	2.4	Marginally saline
18	Pazhaverkadu	8.09	0.3	3.90	1.9	Good
19	Thathaimanjai	8.4	1.4	5.35	3.2	Marginally alkali
20	Kattur	8.78	3.56	11.73	8.4	Highly alkali
21	Vayalur	8.15	2.19	10.1	5.2	Highly alkali
22	Minjur-I	7.81	2.79	4.53	0.4	Marginal Saline
23	Velliyal chavadi	7.75	1.66	7.10	0.2	Good
24	Edayan chavadi	8.34	3.05	11.45	3.9	Highly alkali
25	Enoor	8.1	2.49	15.1	2.2	Highly alkali

**Table 3. Puzhal**

Sample No	Village name	pH	EC	SAR	RSC	Water Quality Categories(CSSRI)
1	aandar kuppam	8.35	1.6	10.01	3.4	Marginal Alkali
2	Kadapaakkam	7.84	2.91	6.76	0.8	Marginal Saline
3	Kosapur	7.77	1.44	3.53	-0.8	Good
4	Vadaperumbaakkam	8.11	1.74	5.76	2.6	Marginally alkali
5	Manjampakkam	8.25	1.47	3.81	2.5	Marginally alkali
6	Kavanangkarai	8.36	1.94	8.36	3.2	Marginally alkali
7	Puzhal	8.11	0.76	1.67	2	Good

**Table 4. Gummidipoondi**

Sample No	Village name	pH	EC	SAR	RSC	Water Quality Categories(CSSRI)
1	Puthuvayal	8.76	0.8	5.22	3.6	Marginally alkali
2	Keelmudalambedu	8.11	2.07	5.58	2.6	Marginally alkali
3	Kavaraipettai	8.21	0.6	3.7	3.2	Marginally alkali
4	Verkadu	8.04	2.03	6.31	2.6	Marginally alkali
5	Old Gummidipoondi	8.27	0.49	1.64	2.5	Marginally alkali
6	Chinobulapuram	7.35	0.48	1.73	0.4	Good
7	Thurapallam	7.39	0.8	3.63	-0.3	Good
8	Panangad	7.81	0.2	0.93	0.4	Good
9	Elavur	7.73	0.66	1.02	-3.6	Good
10	Pedhikuppam	8.3	0.66	2.15	2.6	Marginally alkali
11	New gummidipoondi	7.95	1.6	0.6	-2.8	Good
12	Kuruvattucheri	8.27	0.98	2.21	2.8	Marginally alkali
13	Enathimelpakkam	8.29	0.66	3.87	4.2	Alkali
14	Ayanallur	8.46	0.45	3.25	3.2	Marginally alkali
15	Rettambedu	7.99	1.03	3.25	-2	Marginally alkali
16	Kuruviagaram	7.77	2.15	4.76	-4.4	Good
17	Vazhuthalambedu	7.98	0.79	5.87	-0.8	Good
18	Athupakkam	8.4	0.55	6.87	4.8	Alkali

irrigation is a critical strategy for overcoming this problem [11]. The addition of organic manures such as FYM and compost also helps to reduce the negative effects of salinity caused by the release of organic acid during decomposition. In addition, green manure crops should be planted to reduce alkalinity risks. Then, modify in-situ rainwater conservation for the leaching of salts collected in soil from saline and alkali water irrigation. Low rainfall, extended drought and overexploitation of groundwater may increase the levels of various types of saline/sodic problems [12].

### 3.5 Groundwater Quality Map Using GIS

The groundwater samples were classified based on their EC, SAR, and RSC values (Table 1). Arc

Map 10.1 was used to create a groundwater quality map for each parameters of pH, EC, SAR and RSC of Minjur, Puzhal, Gummidipoondi blocks in Tiruvallur district (Figs. 1,2,3). Arc Map 10.1 was used to create a groundwater quality map for Minjur, Puzhal, Gummidipoondi blocks in Tiruvallur district (Fig. 4). It demonstrates that inverse distance weighted (IDW) interpolation in a GIS tool is especially useful for comparing the spatial distribution of water quality parameters [13,14,15]. The map shows that groundwater quality is deteriorating in coastal blocks due to anthropogenic activities such as groundwater pumping near the coastal area, which causes seawater intrusion, and waste discharged from industrial / agricultural activities, which reduces groundwater quality.

Mapping of pH, EC, SAR, RSC for all the coastal blocks of Tamil Nadu:

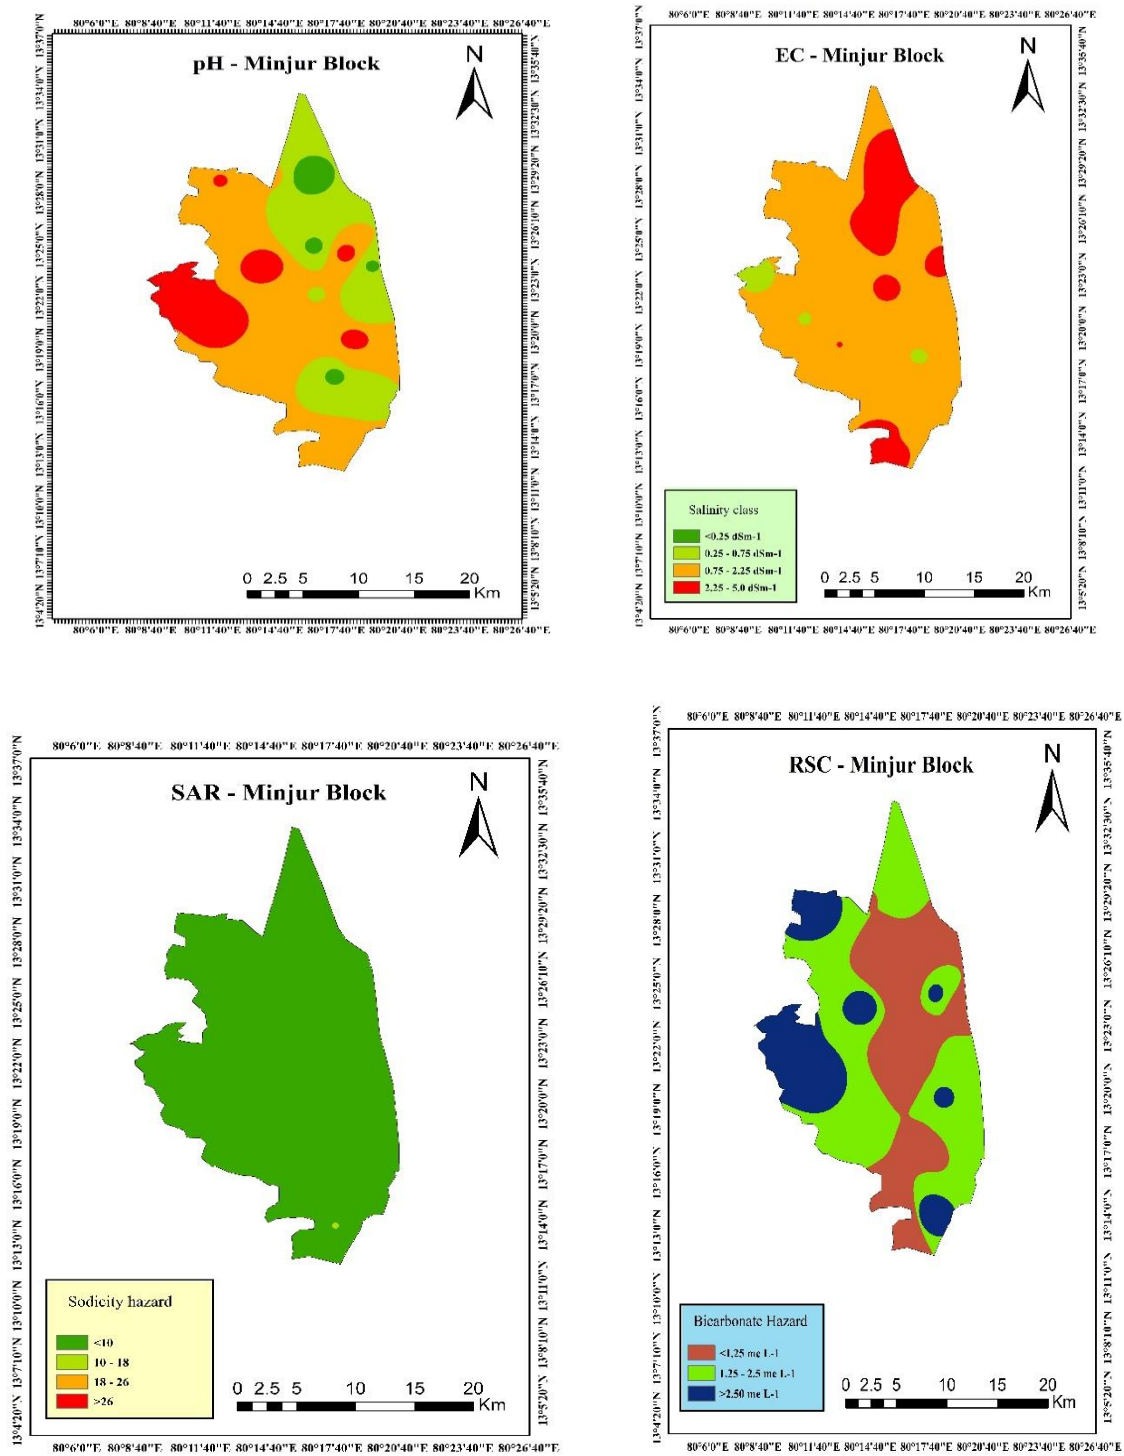


Fig. 1. Minjur Block

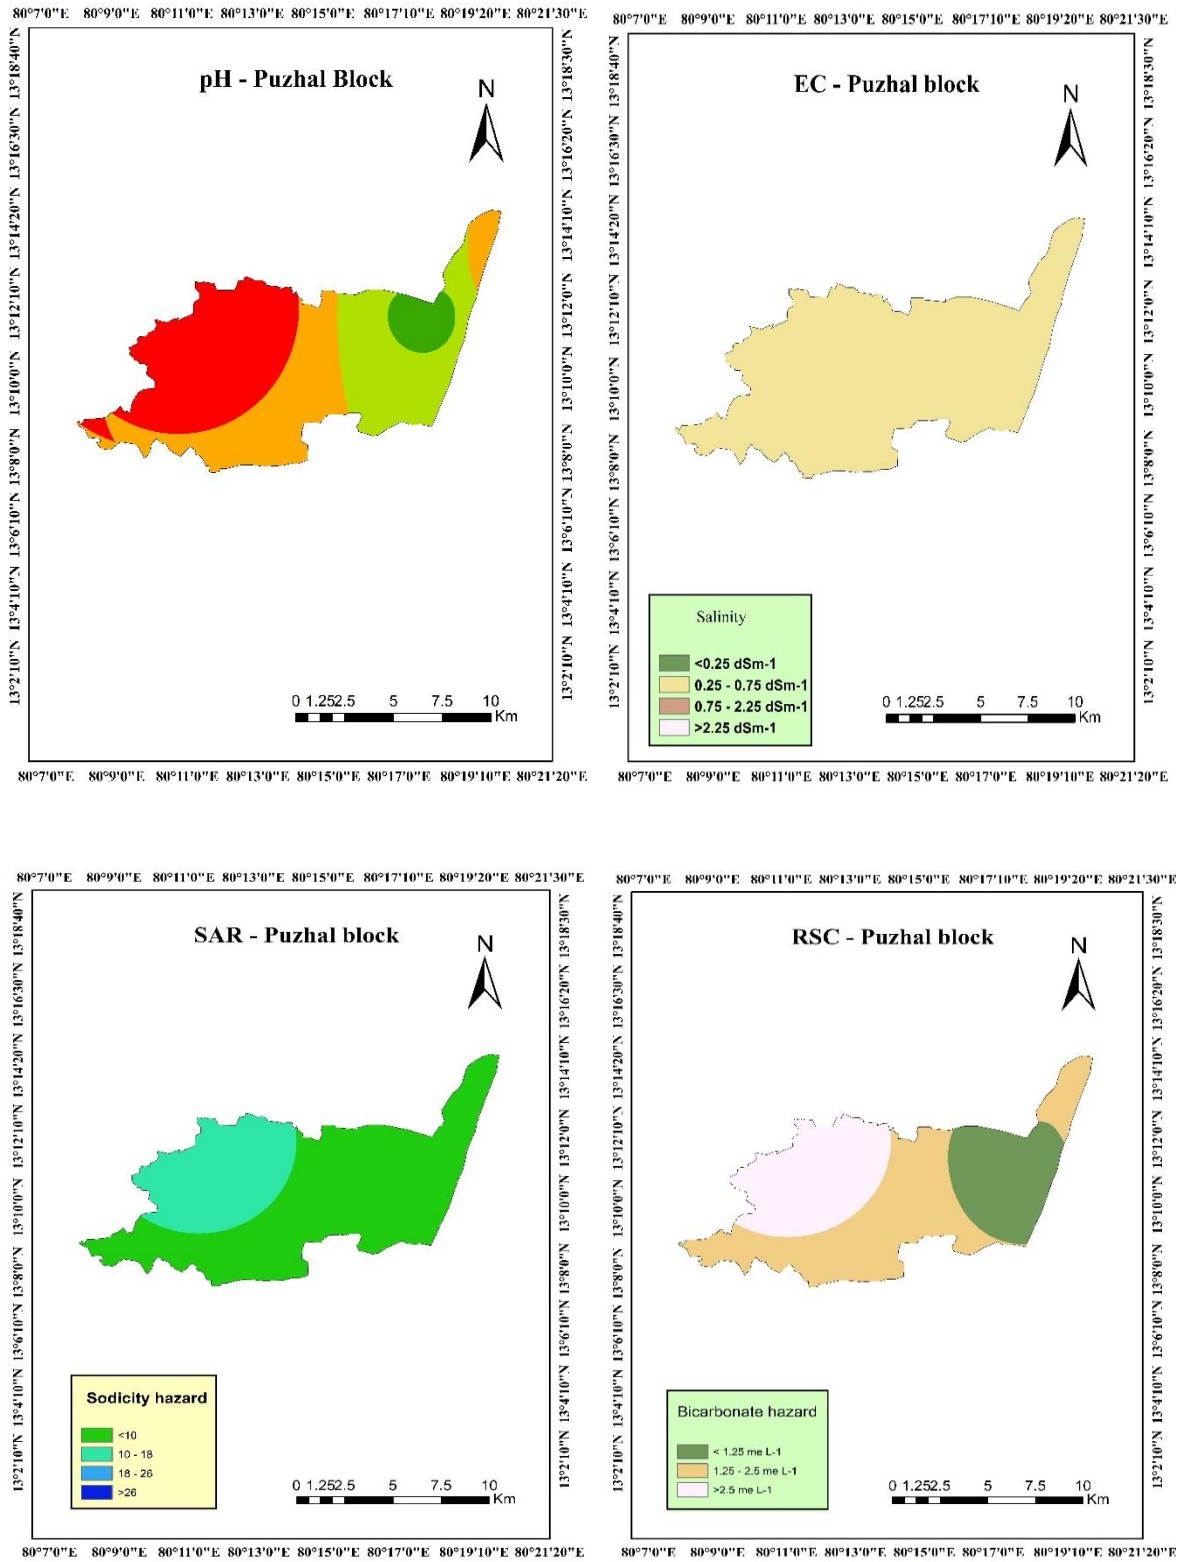


Fig. 2. Puzhal block



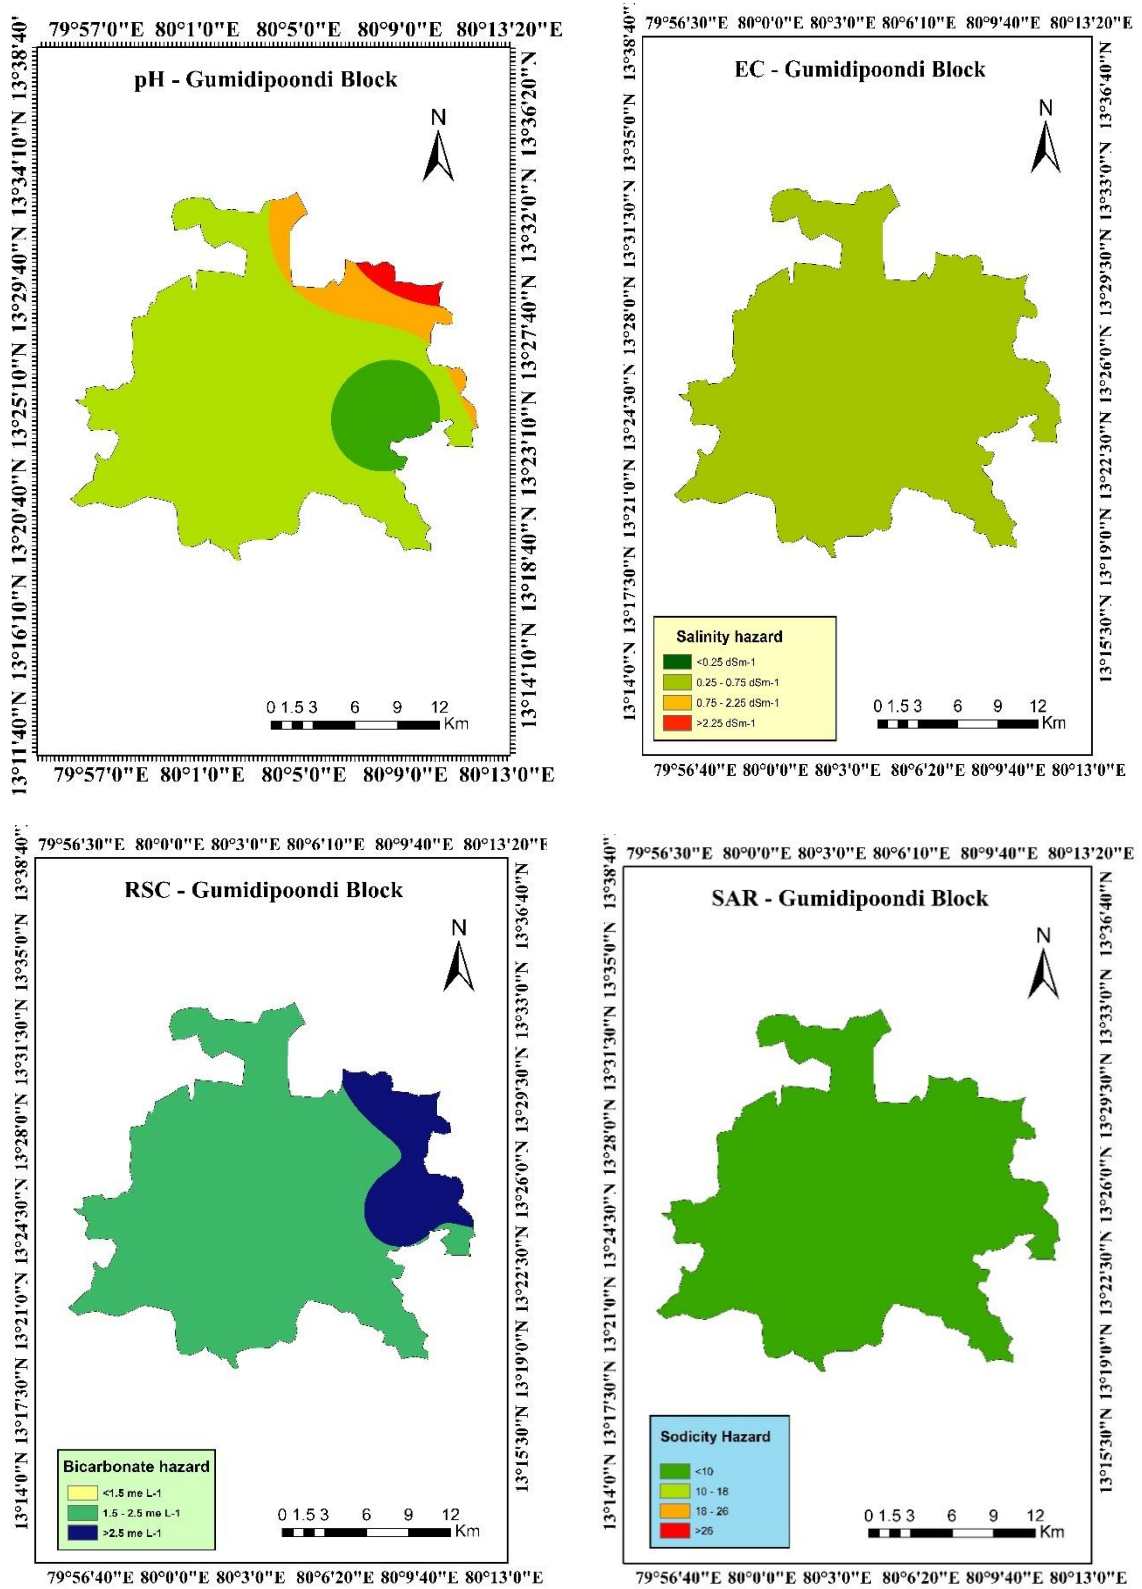
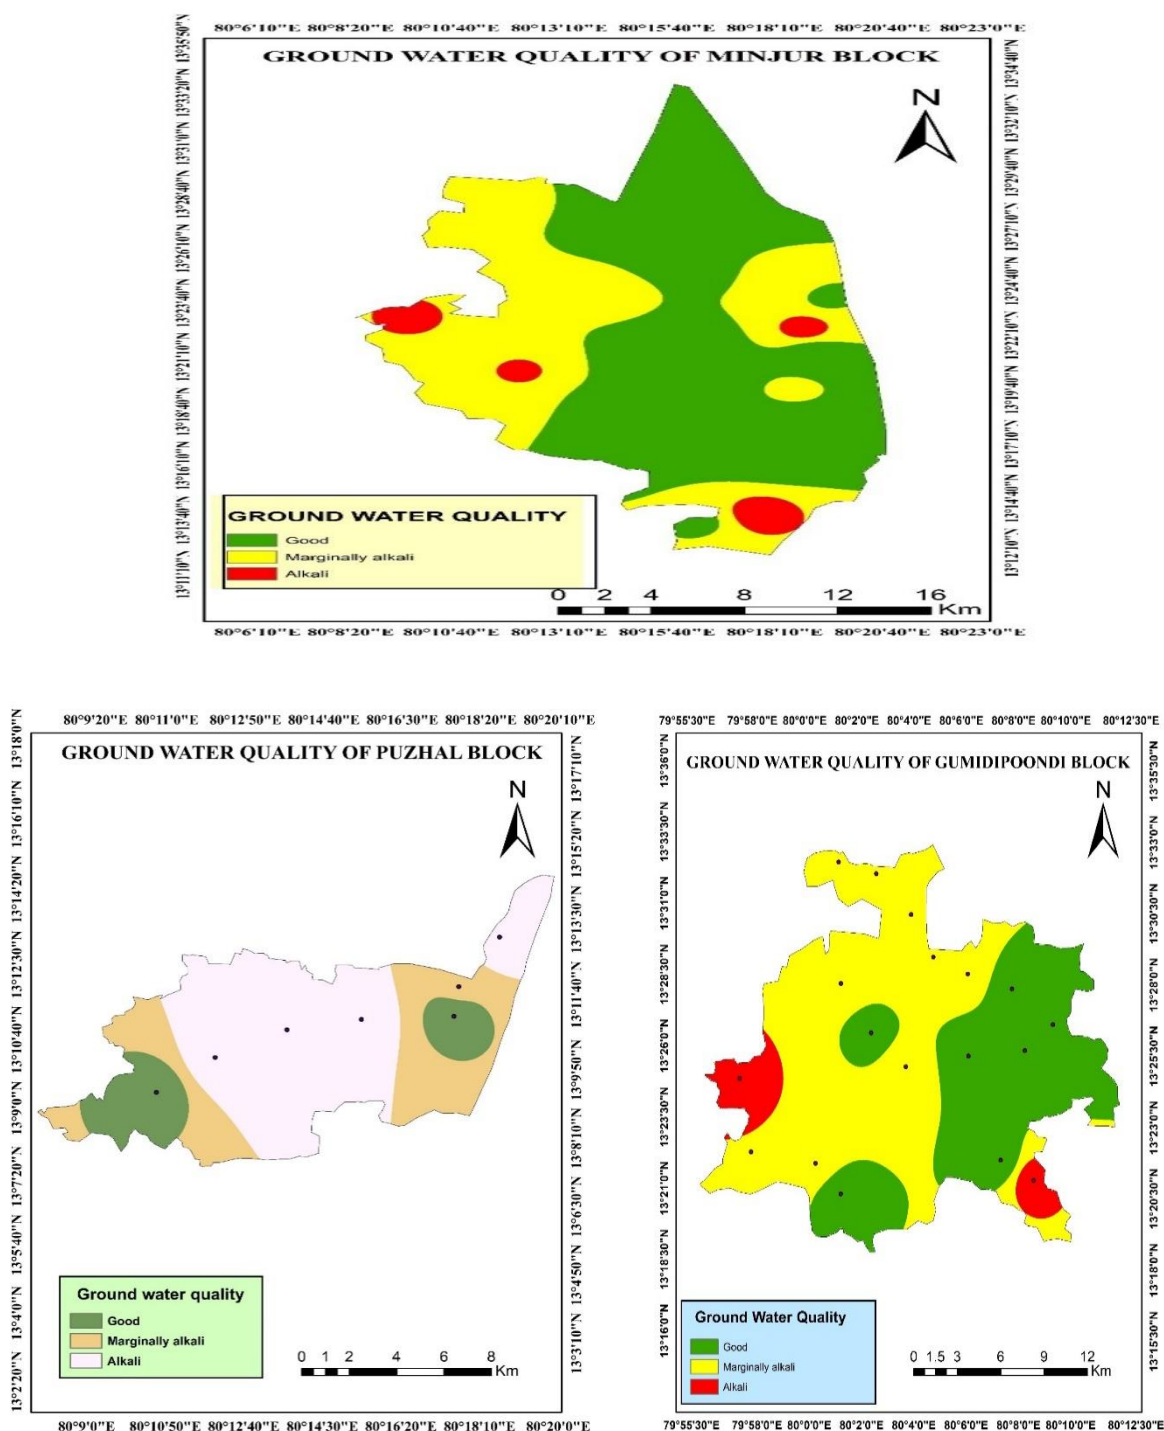


Fig. 3. Gummidipoondi block





**Fig. 4. Spatial distribution of different quality parameters of groundwater in coastal blocks of Tiruvallur district**

#### 4. CONCLUSION

The marginally and highly alkali water was highest in Puzhal block (57.14 per cent & 8 per cent).The alkali water was highest in

Gummidipoondi block (11.11 per cent). The groundwater samples near the coastal area were saline and alkaline, but the groundwater samples far away from the coastal area were of good quality. So that any salinity or

alkalinity issues do not harm the good-quality samples.

## 5. SUMMARY

At Minjur block, good quality water was around 32 per cent; Marginally saline water was around 24%; Marginally alkali water was 20%; Highly alkali water was 8%; and alkali water was 8%. At Puzhal block, good quality water was around 28.57 per cent; Marginally saline water was around 14.28%; Marginally alkali water was 57.14%. At Gummidipoondi block, good quality water was around 38.8 per cent; Marginally alkali water was 44.4%; and alkali water was 11.11%. Marginally saline water was highest in Minjur block (24 per cent). The marginally and highly alkali water was highest in Puzhal block (57.14 per cent & 8 per cent). The alkali water was highest in Gummidipoondi block (11.11 per cent). Most of the samples in the Tiruvallur district area comes under alkali water and marginal saline water and this might be due to the coastal line in these blocks.

## ACKNOWLEDGEMENT

We thank to the Dean ADAC&RI and Professor and Head of the Department of Soil Science and Agricultural Chemistry for their support and guidance.

## COMPETING INTERESTS

Authors have declared that no competing interests exist.

## REFERENCES

- Jha BM, Sinha SK. Towards better management of ground water resources in India. *Bhu-Jal Quarterly Journal*. 2009; 24(4):1-20.
- Srinivasamoorthy K, Vasanthavigar M, Chidambaram S, Anandhan P, Sarma VS. Characterisation of groundwater chemistry in an eastern coastal area of Cuddalore district, Tamil Nadu. *Journal of the Geological Society of India*. 2011;78(6): 549-558.
- Manoj Kumar M, Balasubramaniam P, Gomadhi G, Ramesh T, Jagadeeswaran. Groundwater quality assessment and mapping in coastal blocks of Ramanathapuram district, Tamil Nadu. *IJCS*. 2019;7(3):3185-3188.
- Mohanty AK, Rao VG. Hydrogeochemical, seawater intrusion, and oxygen isotope studies on a coastal region in the Puri District of Odisha, India. *Catena*. 2019; 172:558-571.
- Viveka B, Arunkumar V, Vasanthi D. Assessment of Groundwater Quality in Coastal Areas of Thoothukudi District, Tamil Nadu. *Madras Agricultural Journal*. 2019;106(1-3):38-44.
- Ahamed AJ, Ananthakrishnan S, Loganathan K, Manikandan K. Assessment of groundwater quality for irrigation use in Alathur block, Perambalur district, Tamil Nadu, South India. *Applied Water Science*. 2013;3(4):763-771.
- Santhosh Kumar M, Balasubramaniam P, Selvamurugan M. Assessment of groundwater in mondipatti village and its surrounding area, Tiruchirapalli district, Tamil Nadu, India. *Journal of Pharmacognosy and Phytochemistry*. 2019;8:3524-3528.
- Kawo, Nafyad Serre, Shankar Karuppanan. Groundwater quality assessment using water quality index and GIS technique in Modjo River Basin, central Ethiopia. *Journal of African Earth Sciences*. 2018;147:300-311.
- Prasanth SS, Magesh NS, Jitheshlal KV, Chandrasekar N, Gangadhar K. Evaluation of groundwater quality and its suitability for drinking and agricultural use in the coastal stretch of Alappuzha District, Kerala, India. *Applied Water Science*. 2012;2(3):165-175.
- Sreekala S, Neelakantan R. Spatial Evaluation of water quality for irrigation in Pudukkottai district, Tamil Nadu, India. *International journal of Remote Sensing and Geosciences*. 2015;4(6):8-15.
- Monisha N, Balasubramaniam P, Janaki D, Ramesh T and Mahendran PP. Assessment of groundwater quality and mapping in coastal blocks of Pudukkottai district, Tamil Nadu. 2021;10(10):777-781.
- Vishnu Priya D, P Balasubramaniam, D Janaki, T Ramesh and G Gomadhi. Groundwater quality assessment and mapping in coastal blocks of Viluppuram district, Tamil Nadu. 2021;10(10):965-967.
- Yuvaraj RM. Geo-spatial analysis of irrigation water quality of Pudukkottai district. *Applied Water Science*. 2020; 10(3):1-14.

14. Mondal NC, Singh VS, Saxena VK, Prasad RK. Improvement of groundwater quality due to fresh water ingress in Potharlanka Island, Krishna delta, India. Environmental Geology. 2008;55(3):595-603.
15. Singh KK, Tewari G, Kumar S. Evaluation of groundwater quality for suitability of irrigation purposes: A case study in the Udham Singh Nagar, Uttarakhand. Journal of Chemistry 2020;2020:1-15.

---

© 2022 Reethika et al.; This is an Open Access article distributed under the terms of the Creative Commons Attribution License (<http://creativecommons.org/licenses/by/4.0>), which permits unrestricted use, distribution, and reproduction in any medium, provided the original work is properly cited.

*Peer-review history:*

*The peer review history for this paper can be accessed here:*

*<https://www.sdiarticle5.com/review-history/90775>*